


MONUMENT RECORD

Corner ID: **Wash_K21**

Quarter Corner


Sections 28 & 33- T10N-R01W, 2nd P.M.
Washington Township, Monroe County, Indiana

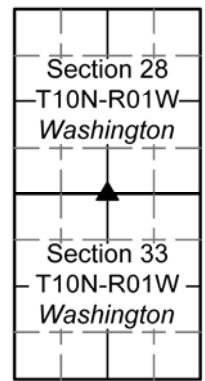

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)

5/8" Rebar with yellow plastic cap stamped "Bledsoe Tapp PC 50920004" 0.2' above grade approximately 40' southwest of the north-west elbow of West Sample Road.

MONUMENT LOCATION SKETCH:

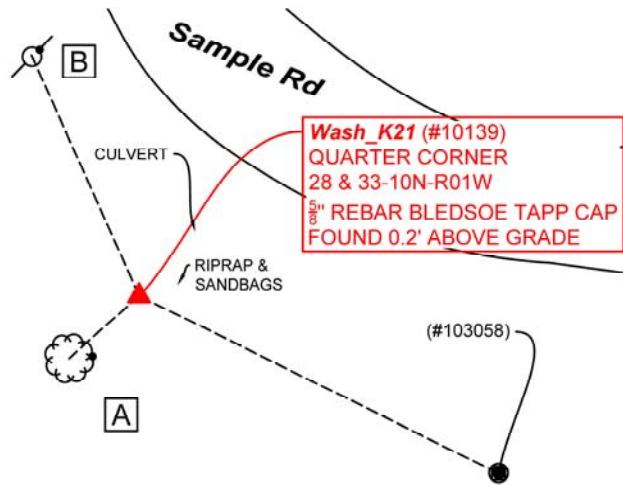

WITNESS MONUMENT TIES

All ties to new Bearing Trees (BTs) are a mag nail set in a 1-1/2" plastic washer stamped "SURVEY MARKER - DO NOT REMOVE" and hack mark at the root crown (less than 12" above ground) perpendicular to the center of the tree, unless otherwise noted. BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail.

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 48d W	15.0'	Mag nail and washer set in hack 0.7' above grade on the east side of a 4" White Ash Tree.
Witness B	N 24d W	42.2'	Mag nail and washer set 0.2' above grade on the northeast side of an 11" power line pole.

MONUMENT ACCESSORIES

Other survey grade monuments that were located in the vicinity and their relation to the monument.

(#103058)	S 63d35'0" E	64.08'	Point collected at center top of 4" water pipeline, blue and white PVC reading, "Warning Water Pipeline Call Before You Dig 811" 4.2' above grade.
-----------	--------------	--------	--



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 3

MONUMENT RECORD

Corner ID: **Wash_K21**

Quarter Corner

Sections 28 & 33- T10N-R01W, 2nd P.M.
Washington Township, Monroe County, Indiana

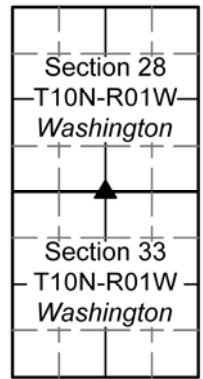


PHOTO IDENTIFIED: *Photo Date: 8/26/2022*



Photo Orientation & Description: Wash_K21 from above



Photo Orientation & Description: Looking southwest at Wash_K21 from Sample Road

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: *Include, search area or areas, search procedure, etc.*

Date of Field work/Search: 08/26/2022 & 3/29/2023 By: JG & HJ Monument Found: Rebar with Bledsoe Tapp cap BTs or Reference Objects Found: None of the witnesses exist from the 2004 Monument Record. Witness B 2004: the powerline pole was new as many of the powerline poles along Sample Road were replaced. Witness C 2004: Major work on Sample Road has been performed in 2022 and 2023. All arrow signs and their anchors are gone. Witness D 2004: Work has been done in drainage area. Project #: Washington Monuments Field Book: 55/03 & 55/30 Equipment: The basis of bearings is Grid North System NAD83(2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b_conus.db3, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Coordinate data was collected with a Javad Triumph LS Network Rover. Coordinates are available upon request. Distances to witness ties were collected with 100' measuring tape. Bearings to witness ties were collected with the internal magnetic compass of the Javad Triumph LS and were automatically adjusted to grid north and are approximately shown hereon for reference. Priority should be given to provided distances over bearings. Notes: All witness photos on file in the Monroe County Surveyors Office.

OTHER EVIDENCE: *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

Wash_K21 is in a drainage area off West Sample Road. The ground is soft, and there are some gravel and landscaping efforts to disperse whatever stormwater issues may exist at this site. The site is south of Canyon Court, and one may park in the brush along the west side of Sample Road.

MONUMENT PRESERVATION: *Describe work done to preserve existing monument.*



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us


Page 2 of 3

MONUMENT RECORD

Corner ID: **Wash_K21**

Quarter Corner

Sections 28 & 33- T10N-R01W, 2nd P.M.
Washington Township, Monroe County, Indiana

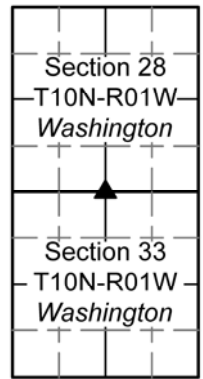

"Protect Nearby Survey Markers" sign was wobbly due to the softness of the ground. MCSO secured the sign at 2.8' above grade and set new witnesses. Geodetic controls were taken for the monument and witness (#103058).

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*
The rebar was previously witnessed by the Monroe County Surveyor, Steven V. Farkas, on December 27, 2004, using the work of licensed surveyor Ben E. Bledsoe (LS #0559). References on File: Tracy L. McGill survey, Location Control Route Survey Plat Proposed I-69 Section 5 Segment 4 (2013), on file at the Recorder's Office as 2013015455.IN, a survey by Daniel J. Isaacs, Plan and Profile Sample Road (2021), on file at the Surveyor's Office as RSID004806 and a survey by Eric L. Deckard, Castillo Boundary Survey (2021), on file at the Recorder's Office as 2021014998.IN. Historic research has not yet been performed to prove the validity of this monument.

CERTIFICATION:



Date: 5/16/2023

Date: 5/16/2023

Trohn Enright-Randolph
Monroe County Surveyor

Accepted by the Monroe County
Surveyor Review Board



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us


Page 3 of 3

MONUMENT RECORD

STATE OF INDIANA ~ COUNTY OF MONROE

Section 28, Township 10 North, Range 1 West,

Monument Description & Remarks: 5/8" Rebar With Plastic Cap Inscribed "Bledsoe Tapp PC 50920004"

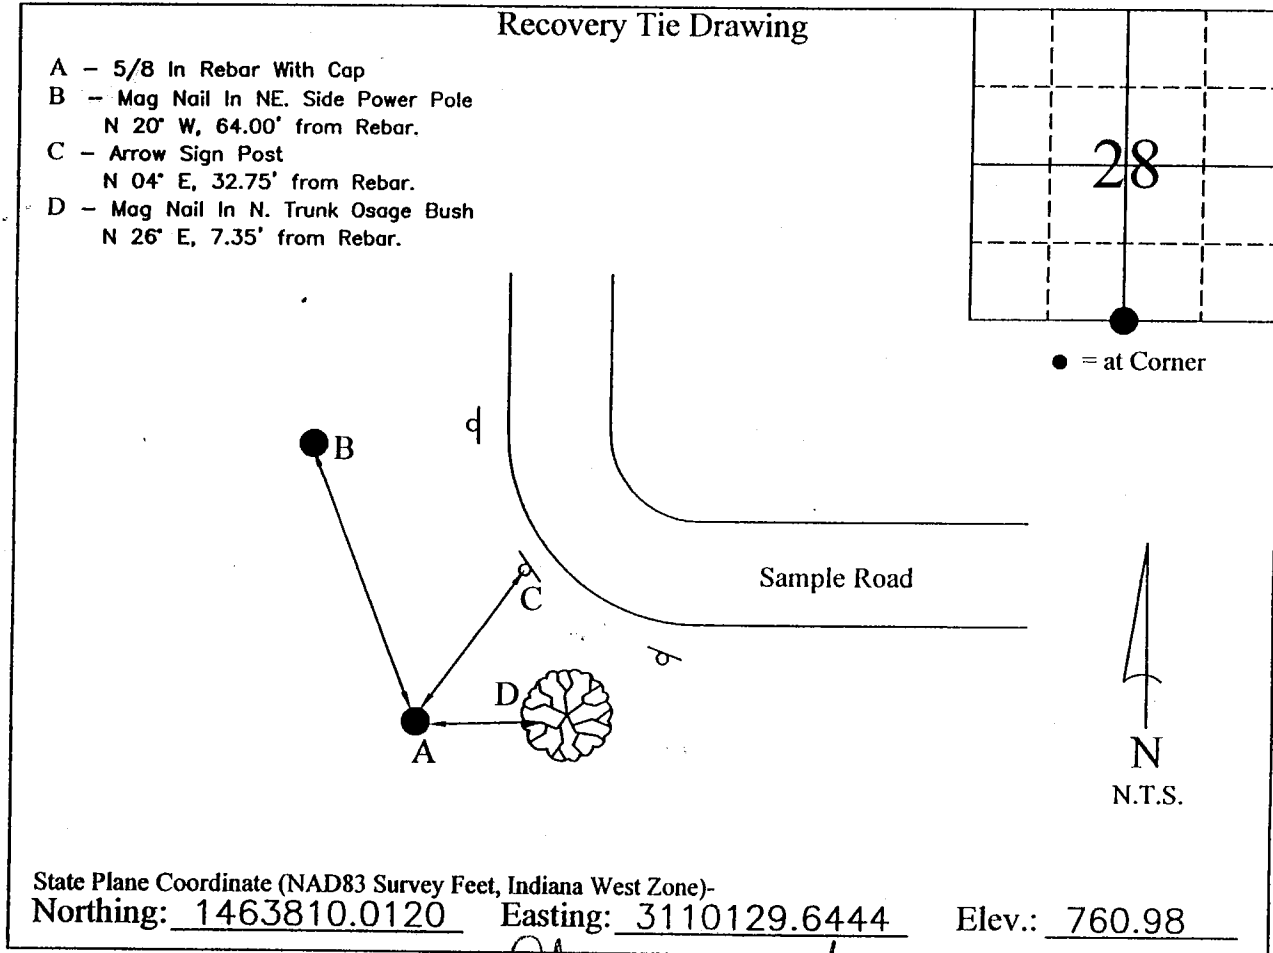


COMPLETED By *Steve U. Fank*

I, Ben E. Bledsoe, Registered Land Surveyor, here by certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; this 27th day of December, 2004 A.D.

Ben E. Bledsoe

Indiana Registered Land Surveyor No. S0559

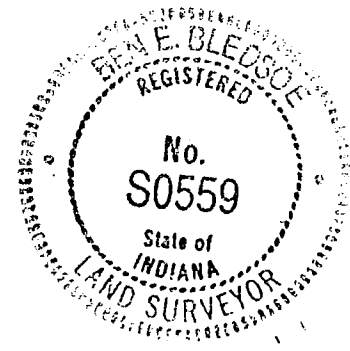

WASH - K - 21

Section 33, Township 10 NORTH, Range 1 WEST

Monument Description & Remarks: BTR CAP 5/8" R/B MARKS the NORTH EAST CORNER of the NORTH EAST 1/4 of the NORTH WEST 1/4.

